



Clamping force block, spring-loaded TANDEM KSF3, KSF3-LH, KSF3-F

Assembly and Operating Manual

Translation of Original Operating Manual

Imprint

Copyright:

This manual is protected by copyright. The author is SCHUNK SE & Co. KG. All rights reserved.

Technical changes:

We reserve the right to make alterations for the purpose of technical improvement.

Document number: 1467140

Version: 06.00 | 17/10/2024 | en

Dear Customer,

Thank you for trusting our products and our family-owned company, the leading technology supplier of robots and production machines.

Our team is always available to answer any questions on this product and other solutions. Ask us questions and challenge us. We will find a solution!

Best regards,

Your SCHUNK team

Customer Management Tel. +49-7572-7614-1300 Fax +49-7572-7614-1039 cmm@de.schunk.com



Please read the operating manual in full and keep it close to the product.

Table of Contents

1	Gen	eral		5
	1.1	About	this manual	5
		1.1.1	Illustration of warning notices	5
		1.1.2	Applicable documents	6
		1.1.3	Sizes	6
	4.3	1.1.4	Variants	6
	1.2		nty	6
	1.3		of Delivery	6
2	Basi		y notes	7
	2.1		priate use	7
	2.2	Inapp	ropriate use	7
	2.3		ural changes	8
	2.4	Spare	parts	8
	2.5	Ambie	ent conditions and operating conditions	8
	2.6	Mater	ial limitations	8
	2.7	Chuck	Jaws	9
	2.8	Persor	nnel qualifications	9
	2.9	Persor	nal protective equipment	10
	2.10	Transp	port	10
	2.11	Protec	tion during handling and assembly	10
	2.12	Protec	tion during commissioning and operation	10
	2.13	Notes	on safe operation	11
	2.14	Dispos	sal	11
	2.15	Funda	mental dangers	11
	2.16	Protec	tion against dangerous movements	12
	2.17	Notes	on particular risks	12
3	Tech	nnical o	data	14
4	Tigh	itening	torques for screws	17
5	Asse	mbly a	and connection	18
	5.1		bly of the Clamping Block on the machine table	
	5.2		ecting the clamping force block	
		5.2.1	Supply lines and lubrication lines	
		5.2.2	Dynamic pressure monitoring of the jaw end positions (variant "PM")	22
		5.2.3	Air coupling in top jaw (variant "PM")	
		5.2.4	Pneumatic circuit diagram	24

6	Maiı	ntenance and care	25						
	6.1	Notes	25						
	6.2	Maintenance and lubrication intervals	25						
	6.3	3 Greasing areas / lubricants							
	6.4	Maintenance work 6.4.1 Lubrication	26 27 30						
7	Trou	bleshooting	32						
8	Stor	age	34						
9	Seal	ing kits, accessory kits and parts lists	35						
		Sealing kit lists	35 36						
		Accessory kits							
	9.3	Parts lists	37						
10	Asse	mbly drawings	39						
		KSF3, KSF3-LH							
	10.2	KSF3-F	40						
44	Man	ufacturer certificate	<i>l</i> .1						

1 General

1.1 About this manual

This manual contains important information for the safe, correct use of the product.

It is an integral part of the product and must be kept accessible for personnel at all times.

Personnel must have read and understood this manual before beginning any work. The observance of all safety notes in this manual is a prerequisite to ensure safe work processes.

The illustrations are intended to provide a basic understanding and may deviate from the actual version.

Besides this manual, other documents which apply are those listed under ▶ 1.1.2 [□ 6]

1.1.1 Illustration of warning notices

To make risks clear, the following signal words and symbols are used for safety notes.



A DANGER

Denotes a hazard with a high degree of risk that, if not avoided, will result in death or serious injury.



A WARNING

Denotes a hazard with a medium degree of risk that, if not avoided, could result in death or serious injury.



A CAUTION

Denotes a hazard with a low degree of risk that, if not avoided, could result in a minor or moderate injury.

CAUTION

Information about avoiding material damage.

1.1.2 Applicable documents

- General Terms and Conditions *
- Catalog data sheet for the attached product *
- Technical data sheet for optional attachments *
- Approval drawings

Documents marked with a star (*) can be downloaded at **schunk.com**.

1.1.3 Sizes

This operating manual applies to the following sizes:

- KSF3 64, 100, 140, 160, 200, 250, 315
- KSF3-LH 64, 100, 140, 160, 200, 250, 315
- KSF3-F 64, 100, 140, 160, 200, 250, 315

1.1.4 Variants

This manual applies to the following variants:

- Pneumatic monitoring (PM)
- Jig-machined positioning bores (Z)

1.2 Warranty

The warranty for standard products is 24 months from the date of delivery from the factory, or 50,000 cycles* for manually operated clamping devices and 500,000 cycles* for power operated clamping devices. For special clamping devices, it is 12 months from the date of delivery from the factory, assuming appropriate use in accordance with the following conditions:

- Observe the applicable documents, ▶ 1.1.2 [☐ 6]
- Observance of the ambient conditions and operating conditions, ▶ 2.5 [□ 8]
- Observance of maintenance and lubrication intervals, ▶ 6.2 [25]

Parts touching the workpiece and wearing parts are not covered by the warranty.

* One cycle comprises one complete clamping procedure ("opening" and "closing").

1.3 Scope of Delivery

Clamping force block KSF3 or KSF3-LH plus or KSF3-F

(without top jaws)

ACCESSORY KIT:

(for contents, see sealing kit list and parts list) ▶ 9.1 [☐ 35]

2 Basic safety notes

Improper handling, assembly and maintenance of this product may result in risk to persons and equipment if this operating manual is not observed.

2.1 Appropriate use

- The product is used for clamping metal and plastic workpieces on machine tools.
- The product may only be used within the scope of its technical data
- The product is designed to be set up on a machine table or machine pallets.
- The product is intended for industrial and commercial use.
- Appropriate use of the product includes compliance with all instructions in this manual.
- Use suitable top jaws with a suitable interface.
- Clamping workpieces with temperatures between 0°C and 100°C.
- The outer dimensions of the workpiece must be smaller than or at most equal to the outer diameter of the clamping device.
- The workpiece must not undergo plastic deformation while under clamping force (clamping indentations are permissible).

2.2 Inappropriate use

The product is not being used appropriately if:

- the product is used as a press or a punch, as a toolholder, as a lathe chuck, as a drill or as a cutting tool.
- the technical data specified are exceeded during usage.
- workpieces are not properly clamped, paying particular attention to the specified clamping forces.
- the top jaws are not mounted properly.
- the product is not being operated properly.
- the product is operated in the stroke end positions.
- the guideways are overloaded due to the chuck jaws being too high or the selected clamping point being too high.
- the product has been insufficiently maintained.
- the product is used for turning applications over 100 RPM without consulting SCHUNK.
- the product is brought into contact with aggressive media, especially acids.
- the product is used in abrasive blasting processes, especially sandblasting.

2.3 Structural changes

Implementation of structural changes

Modifications, changes or reworking, e.g. additional threads, holes, or safety devices, can damage the product or impair its functionality or safety.

 Structural changes should only be made with the written approval of SCHUNK.

2.4 Spare parts

Use of unauthorized spare parts

Using unauthorized spare parts can endanger personnel and damage the product or cause it to malfunction.

 Only use original spare parts and spares authorized by SCHUNK.

2.5 Ambient conditions and operating conditions

Required ambient conditions and operating conditions

Incorrect ambient and operating conditions can make the product unsafe, leading to the risk of serious injuries, considerable material damage and/or a significant reduction in the service life of the product

- Make sure that the product is only used within its defined application parameters.
- Ensure that the product is of a sufficient size for the application.
- Ensure that maintenance and lubricating intervals are observed.
- When machining, use only coolant emulsions with anti-rust properties.
- Depending on the operating conditions, the function must be checked after a certain period of operation.

2.6 Material limitations

The product is made of steel alloys, elastomers, aluminum alloys and brass. In addition, Microgleit LP 410 grease, Branotect antirust oil and Renolit HLT2 are incorporated into the product as auxiliary and operating materials. The safety data sheet for Microgleit LP 410 can be found at www.schunk.com.

2.7 Chuck Jaws

Requirements of the chuck jaws

When using chuck jaws, please observe the following rules:

- Change chuck jaws at a standstill and without a clamped workpiece.
- Do not use welded jaws.
- Design the chuck jaws to be as low as possible. The clamping point must be as close as possible to the housing. (clamping points at a greater distance cause higher surface pressures in the jaw guides and can significantly reduce the clamping force.)
- If the clamping point is at a greater distance from the housing, the operating pressure must be reduced.
- After a collision, the clamping device and the chuck jaws must be subjected to a crack detection test before being used again. Replace damaged parts with original SCHUNK spare parts.
- The chuck jaw mounting screws and if present, the T-nuts, must be replaced if there are signs of wear or damage. Only use screws of quality grade 12.9 in compliance with the specified tightening torques. For clamping devices with fine serration, the jaw mounting screws must be screwed into the holes closest to the clamping point.

2.8 Personnel qualifications

Inadequate qualification of personnel

Any work on the product by inadequately qualified personnel can lead to serious injuries and considerable material damage.

- All work must be performed by appropriately qualified personnel.
- Personnel must have read and understood the complete manual before beginning any work on the product.
- Observe country-specific accident prevention regulations and the general safety notes.

The following personnel qualifications are required for the various activities on the product:

Qualified electrician

Qualified electricians have the professional training, knowledge, and experience to work on electrical systems, to recognize and avoid potential dangers, and know the relevant standards and regulations.

Specialist personnel

Specialist personnel have the specialized training, knowledge, and experience to perform the tasks entrusted to them, to recognize and avoid potential dangers, and know the relevant standards and regulations.

Instructed person

Instructed persons have been instructed by the operator regarding the tasks entrusted to them and the potential dangers of inappropriate behavior.

personnel

Manufacturer's service The manufacturer's service personnel have the specialized training, knowledge, and experience to perform the work entrusted to them and to recognize and avoid potential dangers.

2.9 Personal protective equipment

Use of personal protective equipment

Personal protective equipment serves to protect staff in the event of a danger that may interfere with their health or safety at work.

2.10 Transport

Handling during transport

Incorrect handling during transport can make the product unsafe and risks the danger of serious injuries and considerable material damage.

- During transport and handling, secure the product to prevent it from falling.
- Use the transport thread on the clamping device.

2.11 Protection during handling and assembly

Incorrect handling and assembly

Incorrect handling and assembly can make the product unsafe and can risk the danger of serious injuries and considerable material damage.

- All work must only be performed by appropriately qualified personnel.
- Secure the system against accidental operation during all work.
- Use suitable assembly and transport equipment and take precautions to prevent jamming and crushing.

2.12 Protection during commissioning and operation

Falling or violently ejected components

Falling and ejected components can lead to serious injury or death.

Take suitable protective measures to secure the danger zone.

2.13 Notes on safe operation

Incorrect manner of working by personnel

An incorrect manner of working can make the product unsafe and risks serious injuries and considerable material damage.

- Observe the safety notes and assembly instructions.
- Do not expose the product to any corrosive media.
 Products for special ambient conditions are excluded.
- Rectify malfunctions as soon as they occur.
- Observe the care and maintenance instructions.
- Observe the current safety, accident prevention, and environmental protection regulations for the application field of the product.
- Do not start the machine spindle until the force has built up in the chuck jaw and clamping is complete in the permissible operating range.
- Unclamping may only occur once the machine spindle has come to a standstill.

IMPORTANT!

Following a longer shutdown period (more than 8 hours), always re-tension the clamping device in order to compensate for the setting properties of the clamping situation or possible pressure losses and the resulting loss of clamping force.

2.14 Disposal

Handling of disposal

Incorrect handling during disposal can make the product unsafe and risks serious injuries and considerable material and environmental harm.

• Follow local regulations on dispatching product components for recycling or proper disposal.

2.15 Fundamental dangers

General

- Disconnect power sources before installation, modification, maintenance, or calibration. Ensure that no residual energy remains in the system.
- Do not reach into the open mechanism or movement area of the product during operation.

2.16 Protection against dangerous movements

Safe condition

- Clamping force block with workpiece:
 Workpiece clamped outside the end positions of the clamping
 force block with clamping pressure applied.
- 2. Clamping force block without workpiece, without clamping or release pressure applied.
- 3. Clamping force block with spring force:
 Clamped without energy without workpiece.
 Special feature: Due to the built-in spring, an opened clamping force block clamps without release pressure.
 Unexpected clamping movements could result if the release pressure fails. Take suitable measures, e.g. a pilot-controlled check valve with manual venting.

Unexpected movements

If the system still retains residual energy, serious injuries can be caused while working on the product.

 Establish a safe state, switch off the energy supply, ensure that no residual energy remains and secure against inadvertent reactivation.

2.17 Notes on particular risks



A WARNING

Risk of injury in the event of workpiece loss due to component failure on the product as a result of exceeding the technical data.

• The product is only allowed to be used within the scope of its technical data.



A WARNING

Risk of injury due to immediate closing of the product with high spring force in the event of pneumatic pressure failure (AS variant).

- Wait for the system to come to a complete standstill in the safe state.
- Do not reach into the clamping force block.



WARNING

Danger of crushing due to the chuck jaws moving to the workpiece during the clamping procedure when loading and unloading manually.

- Do not reach between the workpiece and the chuck jaw during the clamping procedure.
- Implement the safety functions according to the integrator's risk assessment.



WARNING

Risk of injury in the event of workpiece loss due to failure or pressure reduction.

- Implementing safety functions according to the integrator's risk assessment.
- Ensure stable pressure supply.
- Use pressure maintenance valves.



A WARNING

Risk of injury from falling parts during transport, assembly and disassembly of the product and its accessories.

- Use suitable load handling equipment for transport.
- Do not linger in the danger zone.
- Wear protective equipment (protective shoes).



A CAUTION

Ergonomic risk to the musculoskeletal system when lifting and transporting the product using manual force.

Use load handling equipment for lifting and transporting.



A CAUTION

Allergic reactions or irritation due to skin or eye contact with lubricants on the product.

- In case of foreseeable contact with lubricants on the product (e.g. when lubricating or cleaning),
- wear protective equipment (protective gloves, protective goggles).



A CAUTION

Danger for the operating personnel in case of insufficient clamping force due to ejection or falling of the workpiece!

Due to settling behavior, the clamping force may decrease over time.

- Ensure that the clamping pressure is applied to the clamping force block while the workpiece is being machined.
- Re-clamping of the workpiece with manual or pneumatic clamping force blocks.

3 Technical data

Installation position any

Operating temperature [°C] +5 to +60

Noise emission [dB(A)] ≤70

Compressed air, compressed air quality according to ISO 8573-1:2010 [7:4:4] Pressure medium

Max. speed of rotation [rpm] 100 Opening pressure [bar] 6 - 9


				KSF3						
Designation	64	100	140	160	200	250	315			
Stroke per jaw [mm]	2	2	3	3	4	5	6.5			
Clamping force range* [kN]	2 - 2.5	7 - 12	13 - 18	20 - 30	26 - 35	37 - 50	69 - 95			
Repeat accuracy** [mm]	0.01	0.01	0.01	0.01	0.02	0.02	0.02			
max. jaw height [mm]	60	60	60	60	100	150	200			
Weight [kg]	1.5	4.3	8.5	12.5	25.5	39.4	84.5			
				KSF3-LH						
Description	64	100	140	160	200	250	315			
Stroke per jaw [mm]	4	6	7	8	10	15	18			
Clamping force range without turbo* [kN]	1 - 1.5	3 - 5	6 - 9	10 - 15	11 - 16	15 - 21	27 – 37			
Clamping force range with turbo (6 bar)* [kN]	2.5 - 3	9 - 11	16 - 19	29 - 34	29 - 33	40 - 46	67 - 77			
Max. turbo pressure [bar]	6	6	6	6	6	6	6			
Repeat accuracy** [mm]	0.01	0.01	0.01	0.01	0.02	0.02	0.02			
max. jaw height [mm]	120	150	120	200	500	500	500			
Weight [kg]	1.5	4.4	8.6	12.7	25.7	39.6	85.5			
				KSF3-F						
Designation	64	100	140	160	200	250	315			
Stroke per jaw [mm]	4	4	6	6	8	10	13			
Clamping force range* [kN]	2 - 2.5	7 - 12	13 - 18	20 - 30	26 - 35	37 - 50	69 - 95			
Repeat accuracy** [mm]	0.01	0.01	0.01	0.01	0.02	0.02	0.02			
max. jaw height [mm]	60	60	60	60	100	150	200			
Weight [kg]	1.5	4.3	8.5	12.6	25.5	39.4	84.5			

Clamping force is the arithmetic sum of the individual forces occurring at the chuck jaws at distance "H" (see also catalog).


The maximum clamping force is achieved in the open position.

The min. clamping force is applied shortly before the closed position.

Distribution of the clamping position with 100 consecutive clamping operations.

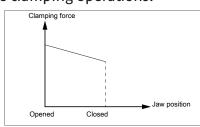

Dependency clamping force to jaw stroke

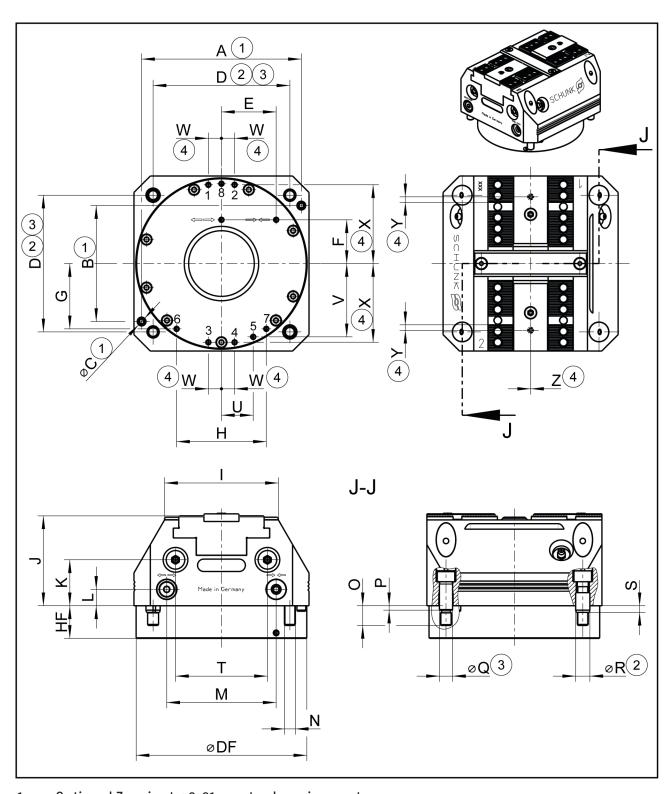

- 1 Optional Z variant ±0.01 mm to clamping center
- 2 Clamping sleeve ±0.04 mm to clamping center
- 3 Fitting screw ±0.02 mm to clamping center
- 4 Only with variant "PM"

	KSF3 / KSF3-LH / KSF3-F								
Dimension	64	100	140	160	200	250	315		
A [mm]	36	90	126	146	184	230	290		
B [mm]	56	64	92	106	146	154	230		
Ø C [mm]	4H7 x 7.5	6H7 x 12	8H7 x 14	8H7 x 14	8H7 x 14	10H7 x 20	10H7 x 20		
D [mm]	50	80	110	125	160	200	250		
E [mm]	17	29.5	44	50	64.5	75	100		
F [mm]	17	32	45.5	40	64.5	64	108		
G [mm]	21	34.5	51.8	59.7	72	92.6	112		
H [mm]	33.6	55	74	82	116	139.6	192		
I [mm]	41	64	91	104	138	170	220		
J [mm]	50.7	69.2	72.7	82.2	90.2	98.2	136		
K [mm]	26	36	28	42	48	52	73		
L [mm]	12	10	13.5	15	17.5	20	20		
M [mm]	34	59	88	100	129	150	200		
N [mm]	M6	M8	М8	M10	M12	M12	M16		
0 [mm]	12	15	15.5	18	21	20	26		
P [mm]	2.5	4	3.5	4	6	5	5		
Ø Q [mm]	8f7	10f7	10f7	12f7	14f7	14f7	18f7		
Ø R [mm]	8	11	11	13	16	16	21		
S [mm]	4	4.5	5.5	6	6	6	6		
T [mm]	28	54	76	84	110	140	180		
U [mm]	0	18.7	26	29	41	54	65		
V [mm]	27	40	58.5	67	83	104	132		
W [mm]	6	9.5	12	12	17	18	25		
X [mm]	26.5	43	63	72	91	115	146		
Y [mm]	7.3	6	6	5	9	20	37.5		
Z [mm]	2.5	4.5	0	0	0	0	0		
HF [mm]	19.8	19.8	24.8	29.8	34.8	39.8	54.8		
ØDF [mm]	61.5	97.7	138	156	196	246	311		

4 Tightening torques for screws

Tightening torques for mounting the clamping system on the machine table (screw quality 10.9)

Screw size	M4	M5	M6	M8	M10	M12	M14	M16	M18	M20	M22	M24
Tightening torque M _A (Nm)	4.2	7.5	13	28	50	88	120	160	200	290	400	500

Tightening torques for mounting top jaws on the TANDEM clamping force block (screw quality 12.9)

Screw size	M4	M5	M6	M8	M10	M12	M14	M16	M20	M24
Tightening torque M _A (Nm)	5	9	15	32	62	108	170	262	510	880

Tightening torques for mounting the chuck piston onto the cylinder piston (screw quality 12.9)

Size		64	100	140	160	200	250	315
Designat ion	Screw size	M5	M8	M10	M10	M12	M12	M2 0
KSF3	Tightening torque M _A (Nm)	9	32	62	62	108	108	510
KSF3-LH	Tightening torque M _A (Nm)	9	32	62	62	140	140	510
KSF3-F	Tightening torque M _A (Nm)	4	25	50	50	90	90	290

Tightening torques for mounting the cover on the body (screw quality A2-70)

Size	64	100	140	160	200	250	315
Screw size	М3	M5	M5	M5	M6	M6	M8
Tightening torque M _A (Nm)	1	4.5	4.5	4.5	7	7	16

5 Assembly and connection

The numbers shown for individual components refer to the illustrations for assembly or connections of the clamping force block and to the "Assembly Drawings" chapter, ▶ 10 [☐ 39].



A WARNING

Danger of crushing due to the product approaching the machine table during assembly

Do not reach between the product and machine table during assembly




A CAUTION

Danger of abrasions due to rough components of the product and its accessories, which may slip out of your hands during assembly.

 Wear protective equipment (protective gloves) when working on the product and when handling its accessories

5.1 Assembly of the Clamping Block on the machine table

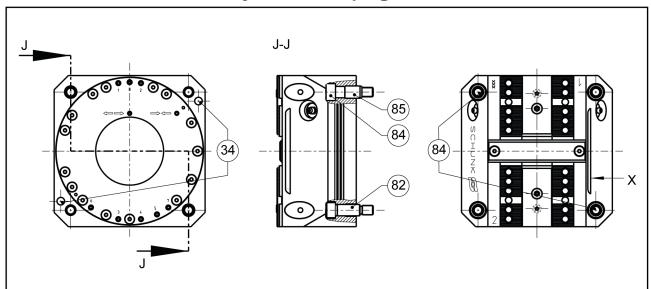

34	Cylindrical pins Ø m6▶ 9.3 [🗅 37]
82	Fitting screw Ø f7 ▶ 9.3 [37]
84	Screw DIN EN ISO 4762
85	Clamping sleeve DIN EN ISO 13337

NOTE

- For vertical installation, the openings of the coolant drain (V) must always face downwards
- Surface "X" is parallel to the guideway of the base jaws (item
 2) in order to be able to align the clamping force block on the machine table or check the positioning.

Assembly with clamping sleeves: Mount the clamping force block on the machine table together with clamping sleeves (item 85) and screws (item 84).


Assembly with fitting screws:

There are two fittings in the housing (item 1) that, along with the fitting screws (item 82), are used to center the clamping force block on the machine table with repeat accuracy. Do not realign the clamping force block after removing it from the machine table (e.g. after replacing the seals). When using fitting screws (item 82), these are used instead of the clamping sleeves (item 85) and two of the four screws (item 84).

Mounting with cylindrical pins (Z variant):

The clamping force block is fastened to the machine table with 4 screws (item 84). The two cylindrical pins (item 34) are used for alignment with repeat accuracy. Do not realign the clamping force block after removing it from the machine table (e.g. after replacing the seals).

5.2 Connecting the clamping force block

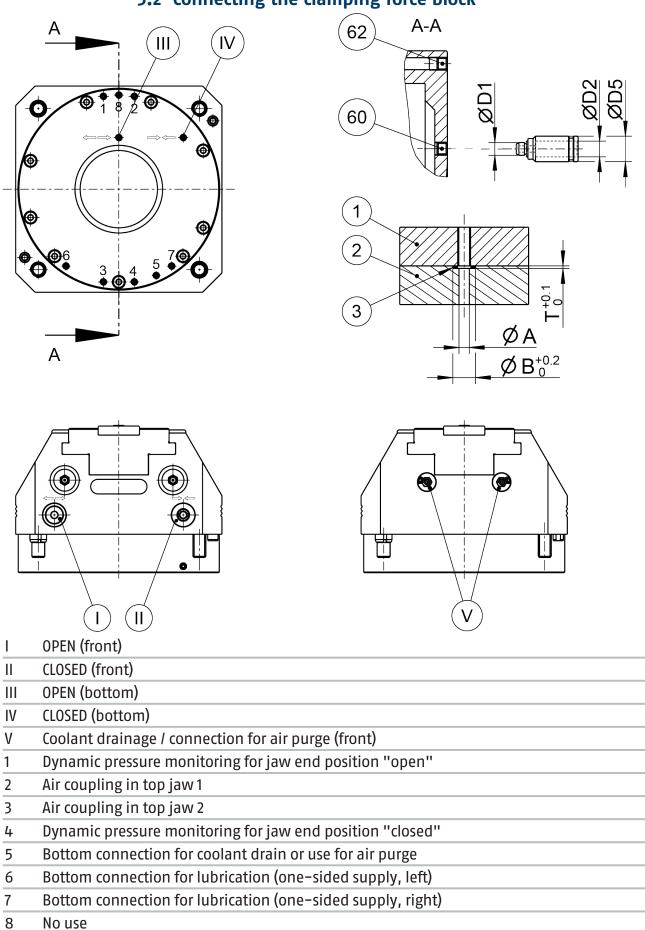

5.2.1 Supply lines and lubrication lines

The clamping force block has four air connections: I, II, III, IV. Two connections for OPEN (I and III) and two connections for CLOSE (II and IV).

The application determines which of the two air connections must be opened for actuation:

- Connections I and II for operation without an adapter plate.
- Connections **III** and **IV** in the base for hose-free direct connection to the machine table or on an adapter plate or for hose fittings.

Thread for pneumatic fitting (front):

KSF3, KSF3-LH, KS3-F 64 and 100 M5 KSF3, KSF3-LH, KSF3-F 140,160, 200 and 250 G1/8 KSF3, KSF3-LH, KS3-F 315 G1/4

Hose-free direct			Size								
connection		64	100	140	160	200	250	315			
Connection	Ø A [mm]		4								
III – IV	Ø B [mm]		8.8								
	T [mm]		1.0								
	0-ring* [mm]		Ø 6 x 1.5								
Connection	Ø A [mm]	3	3 4								
1-8	Ø B [mm]	5.3	5.3 8.8								
	T [mm]	0.6	0.6 1.0								
	0-ring* [mm]	Ø 3.5 x 1			Ø 6 x 1.5			Ø 9 x 2			

*included in	accessory	kit and	sealing kit
IIICIUUCU III	accessor y	KIL UIIU	Jeaning Kit

					Size			
Hose fitting		64	100	140	160	200	250	315
Connection	Ø D1	M5	M5	M5	M5	M5	M5	G1/8
III – IV	Ø D5 max. [mm]	10	10	10	12	12	12	15
	Ø D2 recommended [mm]	6	6	6	6	6	6	8
Connection	Ø D1	М3	M5	M5	M5	M5	M5	M5
1-8	Ø D5 max. [mm]	6	9	9	10	10	12	14
	Ø D2 recommended [mm]	3	4	4	6	6	6	6
	I max. Ø D2 [mm]	1.5	8	8	_	_	_	_

NOTE:

All four air connections come sealed on delivery of the clamping force block. On the base side with set-screws (item 60) and on the front with locking screws (23).

• When using the air purge via connection 5, the two sound absorbers (V) must be removed and replaced by set-screws (item 93), ▶ 9.2 [□ 36].

Requirements for compressed air supply: Compressed air, compressed air quality according to ISO 8573-1:2010 [7:4:4]

Unconditioned compressed air contains dust and oil particles and moisture, all of which can lead to malfunctions or premature wear in the clamping force block. The oiler should be no more than 2 meters from the coupling point.

The clamping force block has two more base connections (617) for direct lubrication through the machine table. These connections come sealed on delivery with set-screws (62).

5.2.2 Dynamic pressure monitoring of the jaw end positions (variant "PM")

Dynamic pressure monitoring for the jaw end positions is integrated via connections 1 and 4 on the bottom.

Connection 1 --> monitoring outer end jaw position.

Connection 4 --> monitoring inner end jaw position.

The max. pressure for the monitoring functions is 2 bar.

Limit volumetric flow to 10 l/min.

Pressure difference between stroke end positions min. 1 bar.

Circuit diagram for external workpiece clamping:

	Circuit diagram							
Connection	1		4					
Signal output	0		1		0		1	
Jaw end position open								
Clamping position								
Jaw end position CLOSED								

Connection	1	4
Jaw end position open clamping force block open	1	0
Clamping position	0	0
Jaw end position closed Clamping force block closed	0	1

Circuit diagram for internal workpiece clamping:

	Circuit diagram							
Connection	1		ļ			4		
Signal output	0		1		0		1	
Jaw end position open								
Clamping position								
Jaw end position closed								


Connection	1	4
Jaw end position open clamping force block closed	0	1
Clamping position	0	0
Jaw end position closed clamping force block open	1	0


NOTES:

- For variants with a fixed jaw, only the outer jaw end position can be monitored at connection 1 (see circuit diagram for workpiece external clamping).
- It is not possible to monitor the clamping position with the "PM" variant. The "IM" variant (inductive proximity switches) is required for monitoring the clamping position.

5.2.3 Air coupling in top jaw (variant "PM")

An air coupling in top jaw 1 is integrated via connection 2 on the bottom and an air coupling in top jaw 2 via connection 3.

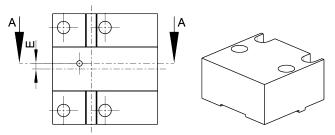

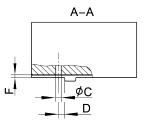

				Size			
Dimension	64	100	140	160	200	250	315
ØC [mm]	2	2	2	2	2	2	4
D [mm]	7.3	6	6	5	9	20	37.5
E [mm]	3.5	5.5	1	1	1	1	3
F [mm]	2 + 0.1	2 + 0.1	2 + 0.1	2 + 0.1	2.5 + 0.1	2.5 + 0.1	2.5 + 0.1

Non-tolerated dimensions according to DIN ISO 2768mH When using top jaws type STR / STR-H / STR-S, it is essential to observe dimension E.

Use for cleaning the clamping surfaces

The customer can create channels in the top jaw in order to clean the clamping and bearing surfaces by means of compressed air. In doing so, the transfer dimensions ØC, D, E and F must be observed.


Dynamic pressure monitoring of the workpiece flat work surface

For this purpose, the customer must provide the top jaw with a Ø2 mm monitoring hole on the workpiece flat work surface. This ensures that the escaping air purge can be released up to where contact is made with the mounted workpiece and that a differential pressure measurement can be carried out via a differential pressure switch.

In doing so, the transfer dimensions ØC, D, E and F must be observed. Max. pressure 2 bar.

Limit volumetric flow to 10 I/min

5.2.4 Pneumatic circuit diagram

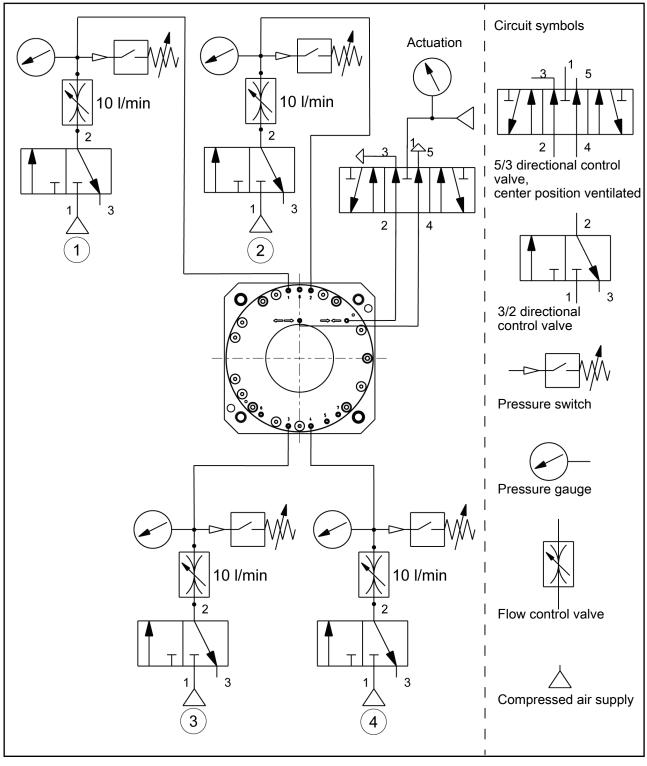

<>	Jaw stroke "open"
> <	Jaw stroke "close"
1	Dynamic pressure monitoring for jaw end position "open" (2 bar)
2	Air coupling in top jaw 1
3	Air coupling in top jaw 2
4	Dynamic pressure monitoring jaw stroke "closed" (2 bar)

6 Maintenance and care



A DANGER

Danger to life in case of improper disassembly. The cylinder piston and the cover are under tremendous spring force, which can eject the parts.

- Any work requiring disassembly of the cover or cylinder piston may only be performed by SCHUNK.
- For basic cleaning, only the base jaws with their attachments, as well as the chuck piston and the cover strip may be dismantled.

6.1 Notes

Original spare parts

Only use original spare parts from SCHUNK when replacing wearing parts/spare parts.

Replacement of the housing and base jaws

The base jaws and the guides in the housing are matched to each other. To replace these parts, send the entire product to SCHUNK with a repair order.

6.2 Maintenance and lubrication intervals

The following maintenance work should be carried out after the specified cycle numbers or, at the latest, according to the monthly data.

Maintenance work	Interval [cycles/month]
Lubrication	10,000 / 1
Basic cleaning	- <i>l</i> 12
Leak test	5,000 / 1

6.3 Greasing areas / lubricants

Greasing areas	Lubricant
Sliding surfaces body – base jaw	microGLEIT LP 410
Sliding surfaces base jaws – chuck piston	microGLEIT LP 410
Lubrication nipple	microGLEIT LP 410
Central lubrication	microGLEIT LP 410
All seals	RENOLIT HLT 2
Sliding surfaces cylinder piston- housing	RENOLIT HLT 2

(Product information about microGLEIT LP 410 & RENOLIT HLT 2 can be requested from SCHUNK).

Alternative Jubricant

LINOMAX plus can also be used as an alternative to microGLEIT LP 410. The specified clamping forces are however based exclusively on microGLEIT LP 410 as used by SCHUNK.

When using LINOMAX plus, the clamping forces can be lower.

6.4 Maintenance work

6.4.1 Lubrication




A CAUTION

Allergic reactions or irritation due to skin or eye contact with lubricants on the product.

• In case of foreseeable contact with lubricants on the product (e.g. when lubricating or cleaning), wear protective equipment (protective gloves, protective goggles).

To maintain reliable function and high quality of the product, it has to be regularly lubricated. This can be done with a hand lever press for greases or by means of central lubrication.


Manual Iubrication

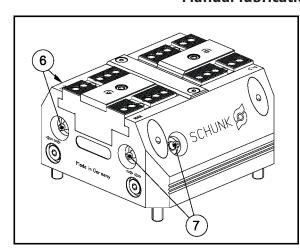

- Press grease either into the grease nipples at the side or front of the respective supply line (6/7).
- Only lubricate in the open position.
- After greasing, run through the complete stroke several times.
- Grease to be used and lubrication intervals, ▶ 6.3 [26].

Size	Grease quantity (strokes per grease nipple)
64	1
100	2
140	2
160	2
200	2
250	3
315	4

Central lubrication

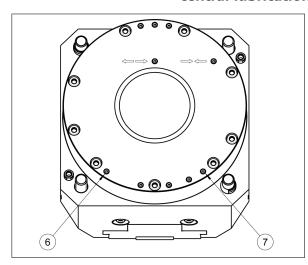

- To use central lubrication, the set-screws of the factory sealed connections (6, 7) must be removed.
- For proper lubrication, both supply lines must be connected.
- The central lubrication system must be suitable for greases of NLGI 2 classification.
- Only lubricate in the open position.
- After greasing, run through the complete stroke several times.
- Grease to be used and lubrication intervals, ▶ 6.3 [□ 26].

Size	Grease quantity (per connection) [cm³]
64	2
100	4
140	4
160	4
200	4
250	4
315	6

6.4.2 Basic cleaning



A DANGER

Danger to life in case of improper disassembly. The cylinder piston and the cover are under tremendous spring force, which can eject the parts.


- Any work requiring disassembly of the chuck piston, cover or cylinder piston may only be performed by SCHUNK.
- For basic cleaning, only the base jaws with their attachments, as well as the chuck piston and the cover strip may be dismantled.

For basic cleaning, the upper part of the product (base jaws with attachments, cover strip and chuck piston) must be disassembled, cleaned and reassembled.


With the "PM" variant, the pneumatic jaw end position control must also be set.

Disassembly


Before disassembling the product, switch off the machine and secure it against being switched on again. Then remove all compressed air lines. No residual energy may be left in the product.

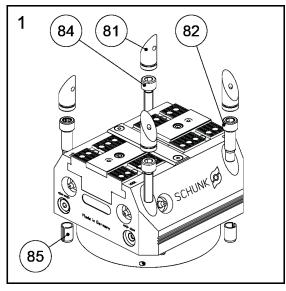


- Pull out the plug (81).
- Unscrew the screws (84) and the fitting screws (82) and disassemble the clamping system from the machine table.
- If using clamping sleeves (85), remove them from the housing.

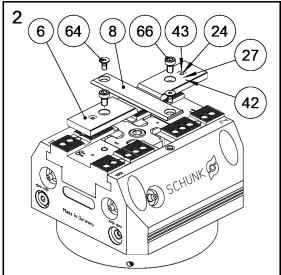

- Remove screws (64) and take off the cover strip (8).
- Remove screws (66) and take off the guide strip (6).
- Variant "PM" also includes a compression spring (27), 0-ring (43), sphere (24) and 0ring (42)

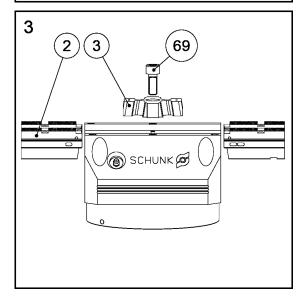


- Remove the screw (69).
- Remove chuck piston (3) and base jaws (2).
 In the case of the PM variant, note that the monitoring elements can fall off when the base jaws are removed.

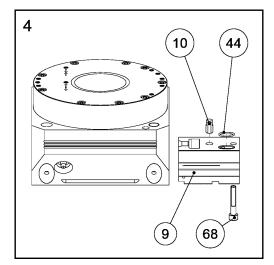

Additionally for the KSF3-F variant:

Remove screw (68). Pull out the positioning bolt (10) via its extraction thread with a screw as far as the stop.

Pull the base jaw (9) out of the housing. Variant "PM" also includes the 0-ring (44).

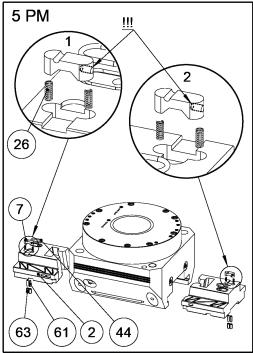

Variant "PM" also includes 0-ring (44), monitoring piece (7) and compression springs (26).

The monitoring element is adjusted and secured with the set-screws (61, 63).


Caution! The monitoring piece is under spring pre-load and is installed directionally oriented for each base jaw! See detail views for jaw 1 and jaw 2!

Maintenance

- Clean all disassembled parts thoroughly and check for damage and wear.
- Treat all sliding surfaces with lubricant ▶ 6.3 [26].
- Replace the seals of the monitoring if necessary ▶ 9.1 [35].
 Assembly is done in the reverse order of disassembly. In doing so, observe the following:
- Pay attention to the mounting position of the base jaws (2) and the chuck piston (3).
- Observe the tightening torques for the screws ▶ 4 [□ 17].
- After completion of the assembly, carry out a leak test and a function test, ▶ 6.4.4 [☐ 31].
- Variant "PM": Pay attention to the correct alignment of the monitoring pieces! When mounting the base jaws, make sure that the 0-ring (44) is not sheared off. Readjust the pneumatic jaw end position control before mounting the guide strips (6) (see ▶ 6.4.3 [□ 31]).

Assembly

6.4.3 Adjustment of the pneumatic jaw end position monitoring (PM)

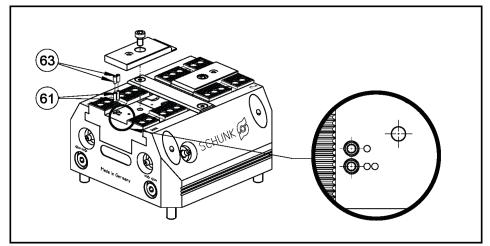

Jaw 1: monitoring open jaw position

- Move base jaws to OPEN position.
- Screw the set-screw (61) into the bore hole "o" up to the stop and then unscrew it again by a few turns.
- Slowly screw the set-screw (61) into the bore hole "**oo**" until the differential pressure sensor emits a switching signal.
- Hand-tighten the set-screw (61) in the bore hole "o".
- Screw set-screw (63) in both bore holes and hand-tighten.

Jaw 2: monitoring closed jaw position

- Move base jaws to CLOSED position.
- Screw the set-screw (61) into the bore hole "**oo**" up to the stop and then unscrew it again by a few turns.
- Slowly screw the set-screw (61) into the bore hole "o" until the differential pressure sensor emits a switching signal.
- Hand-tighten the set-screw (61) in the bore hole "oo".
- Screw set-screw (63) in both bore holes and hand-tighten.

6.4.4 Leak test

The following components are required to check for leaks: pressure gauge, shut-off valve, supply line and quick coupling.

- Check for leaks in the clamping system in the OPEN and CLOSED positions.
- Connect the components to the open CLOSED connection in the following order: pressure gauge – shut-off valve – quick coupling – supply line.
- 2. Pressurize the clamping force block.
- 3. Close the shut-off valve and remove the supply line.
- 4. Let the clamping force block sit clamped for 24 hours.
- 5. After 24 hours, the clamping force block is:
 - sealed if the pressure gauge indicates a drop in pressure of less than 0.5 bar.
 - leaking if the pressure gauge indicates a drop in pressure of more than 0.5 bar.

If the clamping system is leaking, check the fittings first (e.g. with Metaflux leak detection spray). Seal any leaking screws. If the cause of the leak is not the fittings, send the product to SCHUNK for repair.

7 Troubleshooting

Clamping force block chuck jaws will not move

cidinping force block chack jaws will not move			
Possible cause	Solution(s)		
Air supply interrupted	Check air supply		
System pressure too low	Increase system pressure according to clamping system technical specifications		
Connections mixed up	Check connections and functions and connect properly		
Unused air connections not sealed	Seal front or base connections using accessories (included in scope of delivery)		
Active air connections sealed	Remove set-screws from sealed air connections		
Piston will not move			
Possible cause	Solution(s)		

Possible cause	Solution(s)
Air is not oiled	Check maintenance unit, perform maintenance work. Place the oiler closer to the clamping system; adjust the necessary oil quantity
Chuck piston screw broken (overload)	Send clamping system to SCHUNK for repair
Piston rod or piston rod screw connection broken (overload)	Send clamping system to SCHUNK for repair
Active air connections sealed	Remove set-screws from sealed air connections

Clamping force block does not complete stroke

Possible cause	Solution(s)
Chips or dirt between covering strip and base jaws	Unscrew the covering strip (item 8) and remove chips and dirt
Opening pressure too low	Increase opening pressure to required value

Clamping force getting weaker

Possible cause	Solution(s)
Clamping force block not sealed tightly	Check connection and seal screws; reseal or replace
Seals damaged	Send clamping system to SCHUNK for repair
Inadequate lubrication	Lubricate the lubrication nipples with microGleit LP410 ▶ 6 [25]

Clamping force block movement jerky

Possible cause	Solution(s)
Steel guide rollers on sliding surfaces not greased	See ▶ 6 [25]
The monitoring piece in a base jaw is pressed too tightly against the housing	Loosen the adjustment screws and readjust the monitoring piece ▶ 6 [25]

Monitoring functions of the jaw stroke positions do not work properly

Possible cause	Solution(s)
Monitoring pieces in the base jaws not positioned exactly	Readjust monitoring piece for the required function ▶ 6 [25]
Pressure change due to clamping stroke too low	Adjust clamping stroke to the workpiece to >0.3 mm/jaw
Seals damaged	Replace seals in cover and adapter plate ▶ 9.1 [35]

8 Storage

When storing the product for a longer period of time, observe the following points:

- Clean the product and lubricate it lightly.
- Store the product in a suitable transport container.
- Only store the product in dry rooms.
- Protect the product from major temperature fluctuations.

NOTE: Before recommissioning, clean the product and all attachments, check for damage, functionality and leaks.

9 Sealing kits, accessory kits and parts lists

When ordering spare parts, the type, size and, if possible, the serial number of the clamping force block must always be stated to avoid delivery mistakes.

Seals, sealing elements, fittings, springs, bearings, screws, wiper bars and parts that come into contact with the workpiece are not covered by the warranty.

9.1 Sealing kit lists

There are two sealing kits. One for the piston chamber (piston chamber sealing kit) and one for the pneumatic monitoring (monitoring sealing kit). The sealing elements for the bottom connections are included in both sealing kits.

For spring-actuated clamping force blocks (KSF3), only the monitoring/connection sealing kit provided by the customer is relevant.

9.1.1 Piston chamber sealing kit

The piston chamber seals should only be replaced by SCHUNK! Danger to life in case of improper disassembly.

The sealing kit for the piston chamber contains all seals and wearing parts for the parts installed inside (e.g. cylinder pistons).

Sealing kit *	ID
Size 64	1463219
Size 100	1470645
Size 140	1470642
Size 160	1470647
Size 200	1508677
Size 250	1470648
Size 315	1508678

^{*} For included items, see note **X** in the Parts List chapter below. Seals are wearing parts and are recommended to be replaced during maintenance. The sealing kit can only be ordered as a complete kit.

9.1.2 Monitoring sealing kit / connection

The sealing kit for monitoring includes all seals and wearing parts for the pneumatic monitoring of the PM variants, as well as the 0-rings of the bottom connections.

Customers can carry out the basic cleaning themselves with this.

ID
1470480
1470390
1470468
1470482
1470397
1508679
1470398
1508720

^{*} For included items, see note **Y** in the Parts List chapter below. Seals are wearing parts and are recommended to be replaced during maintenance. The sealing kit can only be ordered as a complete kit.

9.2 Accessory kits

Accessory kit *	ID
Size 64	1432277
Size 100	1428583
Size 140	1428599
Size 160	1428591
Size 200/250	1428597
Size 315	1496737

^{*} For included items, see note **Z** in the Parts List chapter below.

9.3 Parts lists

	.	0 111	
Item	Designation	Quantity	Note
1	Body >Housing<	1	*
2	Base jaw	1	F *
	Base jaw	2	*
3	Chuck piston	1	
4	Cylinder piston	1	
5	Cover	1	
6	Guide strip	2	
7	Monitoring piece	1	A / F
	Monitoring piece	2	Α
8	Covering strip	1	
9	Base jaw	1	F
10	Bolt	1	F
21	Cupped-type lubrication nipple	4	64 / 100
	Conical lubrication nipple	4	140 / 160 / 200 / 250 / 315
22	Sound absorber	1	64
	Sound absorber	2	100 / 140 / 160 / 200 / 250
	Sound absorber	3	315
23	Locking screw	1	
	Locking screw	2	LH
24	Steel ball	2	A / Y
26	Compression spring	2	64 / A / Y
	Compression spring	4	100 / 140 / 160 / 200 / 250 / 315 / A / Y
27	Compression spring	2	A / Y
28	Compression spring set	1	
34	Cylindrical pin	2	D / Z
38	Sound absorber	1	64 / 100 / 140 / 160 / 200 / 250
40	Quad ring	1	Х
41	Combined sealing ring	1	X
42	0-ring	2	A / Y
43	0-ring	2	A / Y
44	0-ring	2	Υ
45	0-ring	1	X
48	Flat gasket	9	64 / X
	Flat gasket	10	100 / 140 / 160 / 200 / 250 / 315 / X
60	Set-screw	2	100 / 140 / 315
61	Set-screw	4	64 / 140 / 160 / 200 / 250 / 315 / A


ltem	Designation	Designation Quantity			
62	Set-screw	2	100		
	Set-screw	8	140 / 315		
	Set-screw	10	160 / 200 / 250		
63	Set-screw	2	A/F		
	Set-screw	4	А		
64	Countersunk screw	2	64 / 100 / 140 / 160 / 200 / 250		
	Countersunk screw	4	315		
65	Cylindrical screw	8	64		
	Cylindrical screw	9	100 / 160		
	Cylindrical screw	10	140		
	Cylindrical screw	13	200 / 250 / 315		
66	Cylindrical screw	1	F		
	Cylindrical screw	2			
67	Cylindrical screw	1	F		
68	Cylindrical screw	1	F		
69	Screw	1			
70	Set-screw	1	64 / 160 / 250		
	Set-screw	2	140 / 315		
81	Plug	4	Z		
82	Fitting screw	2	B / Z		
83	0-ring	4	X / Z		
84	Screw	4	C / Z		
85	Clamping sleeve	2	C / Z		
86	Screw	8	Z		
87	0-ring	2	64 X Y Z		
0-ring			0-ring	10	100 / 140 / 160 / 200 / 250 / 315 / X / Y / Z
88	0-ring	7	64 X Y Z		
93	Set-screw	1	64 / Z		
	Set-screw	2	100 / 140 / 160 / 200 / 250 / 315 / Z		
100	Eye bolt	2	200 / 250 / 315 / Z		

64	for size 64	Α	with "PM" variants
100	for size 100	В	Centering with fitting screws
140	for size 140	C	Centering with clamping sleeves
160	for size 160	D	Centering with cylindrical pins (Z variant)
200	for size 200	F	with "fixed jaw" variants
250	for size 250	X	included in the piston chamber sealing kit
315	for size 315	Y	included in the monitoring sealing kit

Z included in accessory kit

^{*} Individual components are specially tuned to one another and cannot be replaced by the customer.


10 Assembly drawings 10.1 KSF3, KSF3-LH

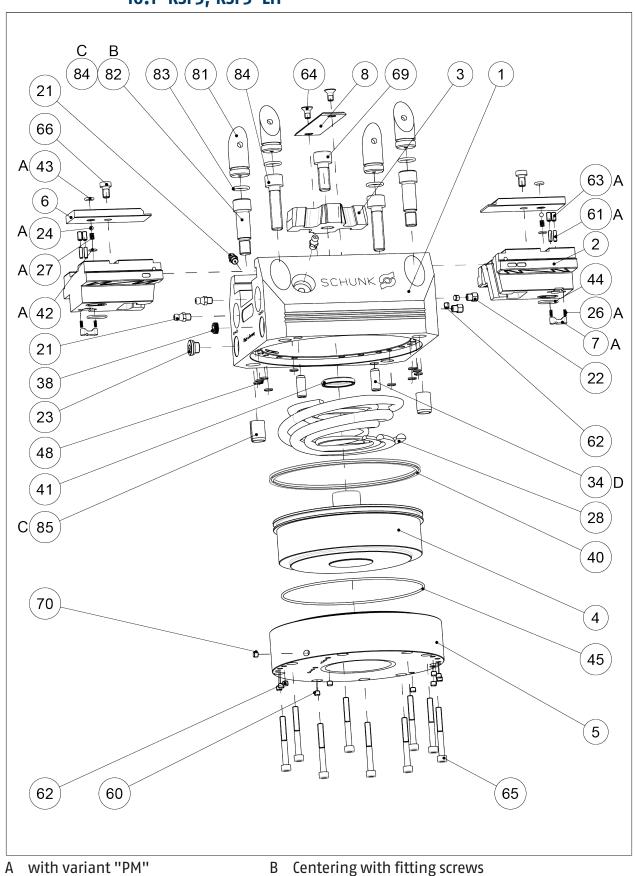

Centering with cylindrical pins (Z variant)

Centering with clamping sleeves

10.2 KSF3-F

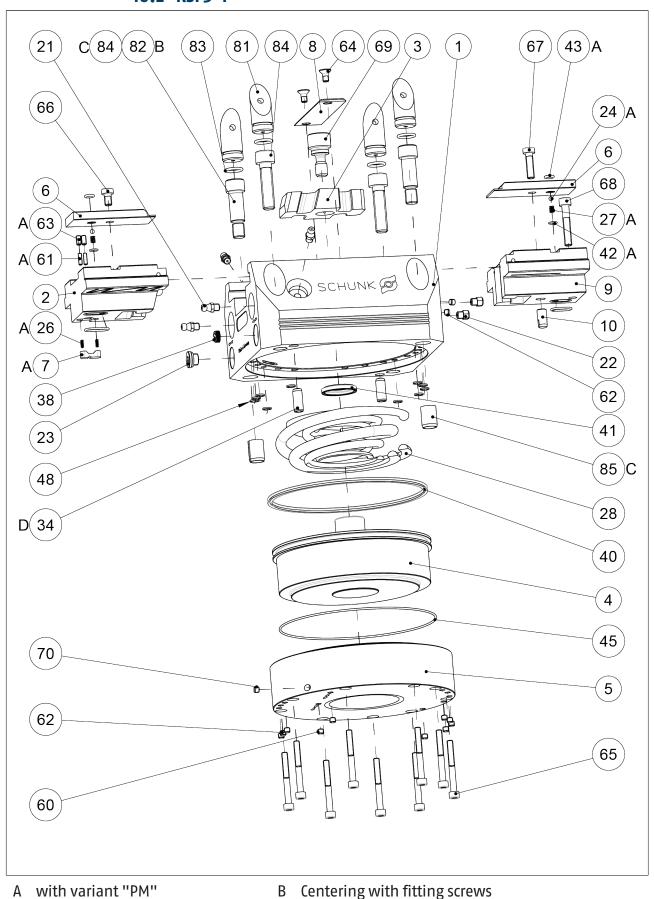

A with variant "PM" B Centering with fitting screws
C Centering with clamping sleeves D Centering with cylindrical pins (Z variant)

11 Manufacturer certificate

Manufacturer / H.-D. SCHUNK GmbH & Co. Spanntechnik KG

Distributor: Lothringer Str. 23 D-88512 Mengen

Product: Clamping force block

Designation: TANDEM
Type designation: KSF, KRF

Heinz-Dieter SCHUNK GmbH & Co. Spanntechnik KG certifies that the above-mentioned products, when used as intended and in compliance with the operating manual and the warnings on the product, are safe according to the national regulations and:

- a risk assessment has been carried out in accordance with ISO 12100:2010.
- an **operating manual** for the assembly instructions has been created in accordance with the contents of the Machinery Directive 2006/42/EC Annex I No. 1.7.4.2. and the contents of the provisions of Annex VI of the Machinery Directive 2006/42/EC.
- Markings have been made in accordance with EN 1550:1997+A1:2008 Section 6.3.1,
 VDMA 34192:2019 Section 6.3 or ISO 16156:2004 Section 6.3. The requirements of
 Annex I No. 1.7.3. of the Machinery Directive 2006/42/EC have been complied with.
- the relevant basic and proven safety principles of the Annexes of **ISO 13849–2:2012**, taking into account the requirements of the documentation have been observed for the component. The parameters, limitations, ambient conditions, characteristic values, etc. for proper operation are defined in the operating manual.
- an MTTF_D value of 150 years can be estimated for mechanical components using the informative procedure in Table C.1 of ISO 13849-1:2015.
- **fault exclusion** against the fault "Unexpected release without pending release signal".
- the **fault exclusion** against the fault "Breakage during operation" in compliance with the parameters, limitations, ambient conditions, characteristic values and maintenance intervals, etc., specified in the operating manual.
- that internal bore diameters in the **pipe or control lines** are at least 2 mm for pneumatic clamping systems and at least 3 mm for hydraulic clamping systems

Harmonized Standards applied:

• **ISO 12100:2010** Safety of machinery – General principles for design – Risk assessment and risk reduction

Other related technical Standards and specifications:

• VDMA 34192:2019 Safety requirements for clamping devices for use on machines


Mengen, 25th of April 2023


Signature: see original declaration Signature: see original declaration

p.p. Philipp Schräder p.p. Alexander Koch

Head of Development standard products

Head of Engineering Design special products

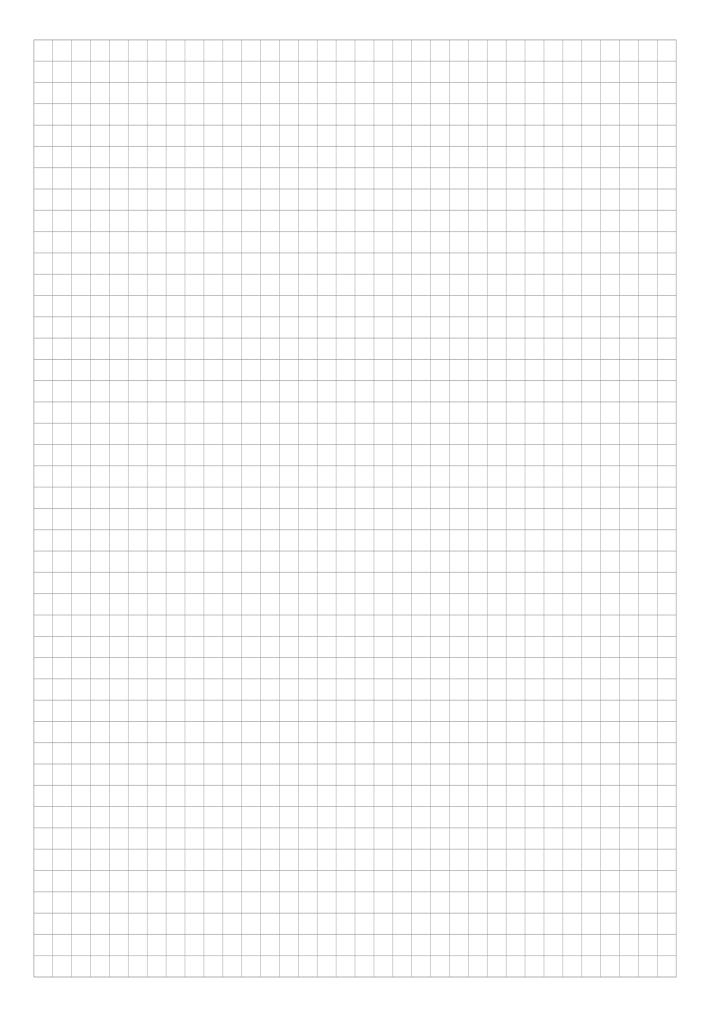

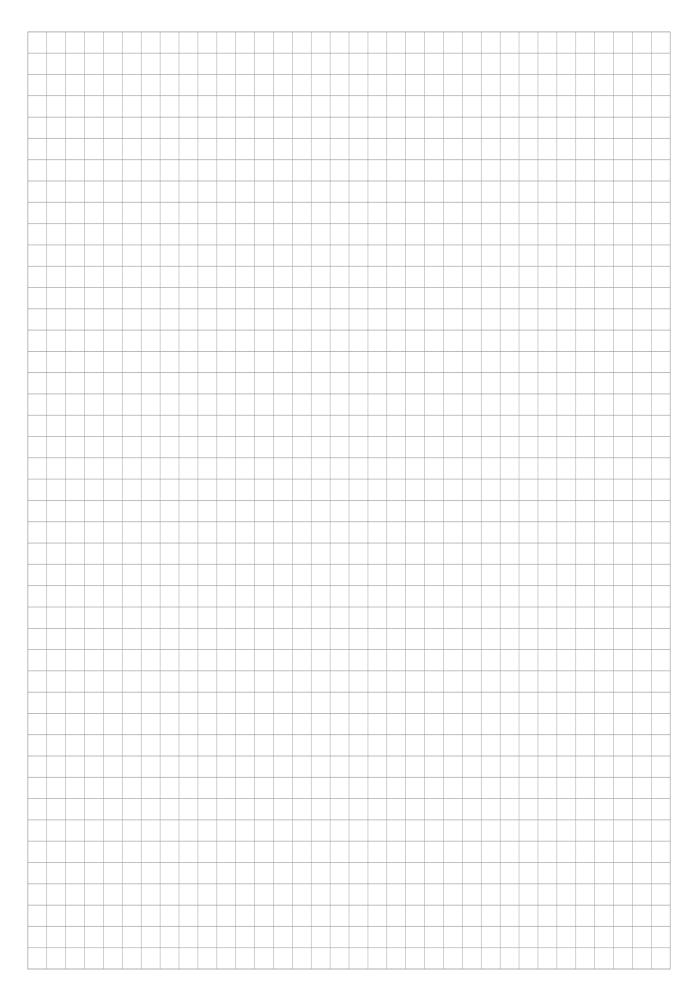







SCHUNK

H.-D. SCHUNK GmbH & Co. Spanntechnik KG

Lothringer Str. 23 D-88512 Mengen Tel. +49-7572-7614-0 info@de.schunk.com

schunk.com

Wir drucken nachhaltig I We print sustainable